
This print and associated documents and the contained information are the confidential property of ELECTRONIC CABLE SPECIALISTS. Disclosure of, and/or reproduction of, all or part thereof or manufacture of any part from information contained on this print not specifically permitted by ELECTRONIC CABLE SPECIALISTS in writing is farbidden.

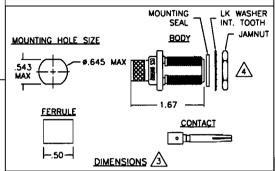

SPECIFICATIONS

ELECTRICAL

IMPEDANCE: 50 OHMS NOMINAL
FREQUENCY RANGE: 0-11 GHz
VSWR: 1.2:1 MAXIMUM DC TO 2GHz
INSERTION LOSS: .1dB MAXIMUM DC TO 2GHz
WORKING VOLTAGE: 1000 VRMS SEA LEVEL
DIELECTRIC WITHSTANDING: 2500 VRMS SEA LEVEL
INSULATION RESISTANCE: 5000 MEGOHMS MINIMUM

MECHANICAL

CONNECTOR INTERFACE DIMENSION PER MIL-STD-348A

• 500 VOLTS DC

FIGURE 304-2 (N)

TERMINATION STYLE: INNER CONTACT-SOLDER ONLY

FERRULE-CRIMP

CABLE RETENTION: 60 LBS

ENVIRONMENTAL

TEMPERATURE RATING: -65' TO +165' C
VIBRATION: MIL-STD-202, METHOD 204, COND. B
SHOCK: MIL-STD-202, METHOD 213, COND. I
THERMAL SHOCK: MIL-STD-202, METHOD 107, COND. B
CORROSION: MIL-STD-202, METHOD 101, COND. B
MOISTURE RESISTANCE: MIL-STD-202, METHOD 106

MATERIALS

BODY: BRASS PER QQ-B-626

FERRULE: ANNEALED BRASS PER QQ-8-626 CENTER CONTACT: BERYLLIUM COPPER PER QQ-C-530

DIELECTRIC: TEFLON PER L-P-403


GASKET: SILICON RUBBER PER ZZ-R-765

<u>FINISHES</u>


BODY, FERRULE: BRIGHT NICKEL PER QQ-N-290
CENTER CONTACT: GOLD PER MIL-G-45204

INSTALLATION INSTRUCTIONS

1. BEGIN BY CUTTING THE CABLE OFF SOUARE.



2. WHEN USING AUTOMATIC STRIPPING EQUIPMENT, STRIP CABLE AS SHOWN STARTING WITH L1 AND ENDING WITH L3. TAKE CARE NOT TO NICK THE CONDUCTORS WHILE STRIPPING THE DIELECTRIC AND JACKET. IF AUTOMATIC STRIPPING EQUIPMENT IS NOT AVAILABLE, STRIP ONLY L1 AND L3 AND TRIM EXCESS BRAID AT STEP 10.



3. SLIDE THE FERRULE AND ADHESIVE SHRINK TUBING 1. OVER THE END OF THE CABLE.



4. SOLDER THE CONTACT ONTO THE CENTER CONDUCTOR, PER MIL-STD-2000, USING 63Sn/37Pb SOLDER. ENSURE THE CONTACT IS BUTTED AGAINST THE CABLE DIELECTRIC. CLEAN ALL FLUX RESIDUES USING AN APPROPRIATE FLUX-CLEANER.




 USING TWEEZERS, FOLD THE OUTER BRAID BACK OVER THE CABLE JACKET, LEAVING AS MUCH WEAVE AS POSSIBLE.



 SLICE THE ALUMINUM/POLYESTER FOIL LENGTHWISE ABOUT EVERY 1/8". GENTLY ROTATE PIN TO SEPARATE THE FLAT FOIL BRAID AND ALUMINUM/POLYESTER FOIL FROM THE DIELECTRIC. USING TWEEZERS, FOLD BACK ALUMINUM/POLYESTER FOIL OVER THE OUTER BRAID.




USING TWEEZERS, FOLD THE INNER BRAID BACK OVER
THE OTHER SHIELDS, LEAVING AS MUCH WEAVE AS POSSIBLE.
NOTE: DO NOT UNRAVEL DIELECTRIC WHEN PULLING
BACK INNER SHIELD.




	REVISIONS								
ECN	ZONE	REV.			DESCRIPTION			DATE	APPROVED
21604	-	N/C	NEW	RELEASE.				12/20/04	DEK
40648	C3 B4	A		4 DEL "OR STYLE SPEC			DIE"	7/16/10	DYK


 SLIDE THE BODY OF THE CONNECTOR OVER THE END OF THE CABLE UNTIL THE NOTCH IN THE CONTACT SEATS WITH THE DIELECTRIC RIDGE INSIDE THE CONNECTOR BODY.



9. FOLD ALL THREE BRAIDS UP OVER THE NECK OF THE CONNECTOR BODY.



10. SLIDE THE FERRULE UP OVER THE SHIELDS AND AGAINST THE CONNECTOR BODY. TRIM AWAY ANY EXCESS BRAID. CRIMP THE FERRULE ONCE, NEXT TO THE BODY, USING THE M22520/5-31 DIE (A HEX) IN A M22520/5-01 TOOL FRAME. APPLY ADHESIVE HEAT SHRINK.



ENSURE HEAT SHRINK IS INSTALLED PRIOR TO CRIMPING CONNECTOR.

ADHESIVE HEAT SHRINK SHOULD BE APPLIED IN ACCORDANCE WITH ECS WORK INSTRUCTION WI007. CONTACT ECS FOR A COPY OF THIS WORK INSTRUCTION.

3 CONNECTOR DIMENSIONS ARE FOR REFERENCE ONLY.

1 INSTALL MOUNTING SEAL, LOCK WASHER AND JAMNUT IN ORDER SHOWN.

ALL LENGTHS IN INCHES			E C S		ELECTRONIC CABLE SPECIALISTS FRANKLIN, WI 53132 PHONE: (414) 421-5300			
APPROVALS	DATE							
DRAWN BY: C CHAPMAN	CUSTOMER SPECIFICATION							
CHECKED BY: D KNOLL 12/20/04		N BULKHEAD JACK FOR ECS CABLE 310701						
DESIGNED BY:		SIZE	CAGE CODE		LEVEL	PART NO.		
PROJECT ENG:		В	6619	7		BNS	002	
ENG. MGR: D KNOLL	12/20/04	SCALE	i	Fil	E NO F:	E/SPEC/COMM/HHST/BHS002	SHEET: 1 OF 1	

A

3

2

1