D

This print and associated documents and the contained information are the confidential property of ELECTRONIC CABLE SPECIALISTS. Disclosure of, and/or reproduction of, all or part thereof or manufacture of any part from information contained on this print not specifically permitted by ELECTRONIC CABLE SPECIALISTS in writing is forbidden.

BODY

The information in this document is subject to the export controls in occordance with the export administration regulations. Diversion contrary to U.S. Law is prohibited.

REVISIONS ECN ZONE REV. DESCRIPTION DATE APPROVED 40680 B2 F ADDED FLAG NOTE 6 7/6/10 CAC 49716 C,D4 G ADDED DIMENSIONS 7/1/13 CA

SLIDE THE BODY OF THE CONNECTOR OVER THE END OF THE CABLE

INSIDE THE CONNECTOR BODY.

HEAT SHRINK.

INSTRUCTION.

DO NOT CRIMP.

1. ALL DIMENSIONS ARE IN INCHES.

AND STEP 7 WOULD BE OMITTED.

NOTES

UNTIL THE NOTCH IN THE CONTACT SEATS INTO THE DIELECTRIC RIDGE

FOLD ALL THREE BRAIDS UP OVER THE NECK OF THE CONNECTOR BODY.

SLIDE THE FERRULE UP OVER THE SHIELDS AND AGAINST

DIE IN A M22520/5-01 TOOL FRAME. APPLY ADHESIVE

/2\ ENSURE HEAT SHRINK IS INSTALLED PRIOR TO CRIMPING CONNECTOR.

ADHESIVE HEAT SHRINK SHOULD BE APPLIED IN ACCORDANCE WITH

4 CONNECTOR DIMENSIONS ARE FOR REFERENCE ONLY.

ECS WORK INSTRUCTION WI0007, CONTACT ECS FOR A COPY OF THIS WORK

PICTORIALS SHOW CONNECTOR INSTALLATION ON ECS 311501 and 311601 CABLE. WHEN INSTALLING THIS CONNECTOR ON 421601 THERE ARE ONLY

WHEN TERMINATING TO 421601 CABLE CENTER CONTACT SHALL BE SOLDERED.


2 SHIELDS WHICH SHOULD BE FOLDED BACK AS SHOWN IN STEP 6

THE CONNECTOR BODY. TRIM AWAY ANY EXCESS BRAID. CRIMP


THE FERRULE ONCE, NEXT TO THE BODY, USING A M22520/5-59

INSTALLATION INSTRUCTIONS


1. BEGIN BY CUTTING THE CABLE OFF SQUARE.

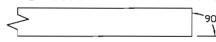

2. WHEN USING AUTOMATIC STRIPPING EQUIPMENT, STRIP CABLE AS SHOWN STARTING WITH L1 AND ENDING WITH L3. TAKE CARE NOT TO NICK THE CONDUCTORS WHILE STRIPPING THE DIELECTRIC AND JACKET. IF AUTOMATIC STRIPPING EQUIPMENT IS NOT AVAILABLE, STRIP ONLY L1 AND L3 AND TRIM EXCESS BRAID AT STEP 10.

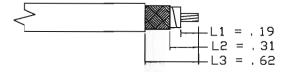

3. SLIDE THE FERRULE AND ADHESIVE SHRINK TUBING OVER THE END OF THE CABLE.

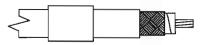


4. SOLDER THE CONTACT ONTO THE CENTER CONDUCTOR, PER MIL-STD-2000, USING 63Sn/37Pb SOLDER OR CRIMP WITH M22520/5-59 DIE (B HEX). ENSURE THE CONTACT IS BUTTED AGAINST THE CABLE DIELECTRIC. CLEAN ALL FLUX RESIDUES USING AN APPROPRIATE FLUX CLEANER.




USING TWEEZERS, FOLD THE OUTER BRAID BACK OVER THE CABLE JACKET, LEAVING AS MUCH WEAVE AS POSSIBLE.



6. SLICE THE ALUMINUM/POLYESTER FOIL LENGTHWISE ABOUT EVERY 1/8". GENTLY ROTATE PIN TO SEPARATE THE FLAT FOIL BRAID AND ALUMINUM/POLYESTER FOIL FROM THE DIELECTRIC. USING TWEEZERS, FOLD BACK ALUMINUM/POLYESTER FOIL OVER THE OUTER BRAID.

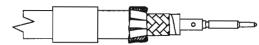

7. USING TWEEZERS, FOLD THE INNER BRAID BACK OVER THE OTHER SHIELDS, LEAVING AS MUCH WEAVE AS POSSIBLE. NOTE: DO NOT UNRAVEL DIELECTRIC WHEN PULLING BACK INNER SHIELD.

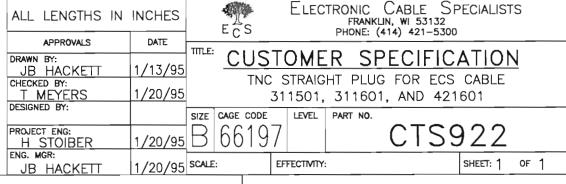

THREE LOCKWIRE HOLES Ø.027 MIN.

SPECIFICATIONS

ELECTRICAL

IMPEDANCE: 50 OHMS NOMINAL FREQUENCY RANGE: 0-11 GHz
VSWR: 1.2:1 MAXIMUM DC TO 2GHz

INSERTION LOSS: .1dB MAXIMUM DC TO 2GHZ WORKING VOLTAGE: 500 VRMS @ SEA LEVEL

DIELECTRIC WITHSTANDING: 1500 VRMS @ SEA LEVEL INSULATION RESISTANCE: 5000 MEGOHMS MINIMUM @ 500 VOLTS DC

DIMENSIONS

MECHANICAL

CONNECTOR INTERFACE: DIMENSIONS PER MIL—STD—348A FIGURE 313—1

TERMINATION STYLE: CABLE CONTACT-SOLDER OR CRIMP

FERRULE-CRIMP
CABLE RETENTION: 40 LBS

ENVIRONMENTAL

TEMPERATURE RATING: -65° TO +165° C
VIBRATION: MIL-STD-202, METHOD 204, COND. B
SHOCK: MIL-STD-202, METHOD 213, COND. I
THERMAL SHOCK: MIL-STD-202, METHOD 107, COND. B
CORROSION: MIL-STD-202, METHOD 101, COND. B
MOISTURE RESISTANCE: MIL-STD-202, METHOD 106

MATERIALS

BODY: BRASS PER QQ-B-626
FERRULE: ANNEALED BRASS PER QQ-B-626
CABLE CONTACT: BRASS PER QQ-B-626
OUTER CONTACT: BERYLLIUM COPPER PER QQ-C-530
DIELECTRIC: TEFLON PER L-P-403
GASKET: SILICONE RUBBER PER ZZ-R-765

BODY, FERRULE AND OUTER CONTACT: BRIGHT NICKEL
PER QQ-N-290

CENTER CONTACT: GOLD PER MIL-G-45204

4

3

2